Technical Service Bulletin # 11

Product: **Incubator 8000 IC / SC / NC**

Date: November 30, 1999

Re: **New hinge brackets for front flap**

Reference Doc: IDM no. 14 / 06.95

Reason: With the blue front-flap hinges as of mid 94, one-handed opening of the flap can result in hinge becoming detached from hinge bracket. The second hinge cannot hold the flap and may break.

Solution: Replacement with new version of hinge bracket 2M 19 542.

Old, with or without plate

New, without plate

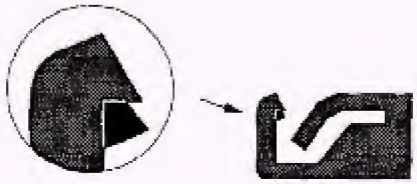

Devices affected: Incubator 8000 series with blue front-flap hinges shipped between mid 1994 and mid 1995.

When: In the event of hinge repair.

Cost: Covered by Customer, post warranty.

Ordering Info: Hinge bracket 2M 19 542

Distribution: Dräger Service Personnel and Authorized Service Organizations for NCS products.

If you have any questions, please contact Technical Support by phone at 1-800-543-5047 or by fax at 1-215-723-5935

Dräger Medical, Inc.
Technical Product Manager

Andreas Lenke